

HARKEN®


INSTALLATION SHEET

2721 High-Beam Small Boat Traveler Track

1251 East Wisconsin Avenue • Pewaukee, WI 53072 U.S.A.

Telephone: (262) 691-3320 • Fax: (262) 691-3008

Web: <http://www.harken.com> • Email: harken@harken.com

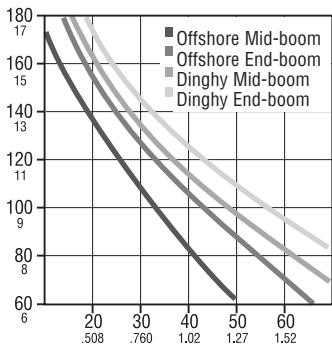

2721 High-beam Small Boat traveler track is designed to be self-supporting to span cockpits or companionways without additional bridge structures.

2721 Track is shipped with 8 bolt slides. Call Harken to order more slides if required (Part No. H-30623A).

5 mm Hexhead bolts required. Call Harken technical service (262) 691-3320 if you have difficulty finding 5 mm Hexhead bolts.

Mounting Track

Place at least three bolts at each end of track with two of those near the span. Where the track is supported, place bolts on 4" (102 mm) centers.

To mount track, calculate hole spacing and drill desired holes in deck, seats or other mounting surface. Slightly bevel top of track hole so bedding compound can mass at top of hole. Place appropriate number of 5 mm hexhead bolts on bolt slides and slip into groove in bottom of track.

Mounting Track Continued

Apply a high-quality bedding compound to the mounting surface around each hole. Place bolts into holes and lower track. Bolt securely using lock washers or locknuts. Most mounting surfaces will require a backing plate for proper strength.



Additional information:
www.harken.com/manuals

Maintenance

Traveler Cars: Clean by frequently flushing with fresh water. Periodically clean car by squirting a detergent/water solution into center openings. Roll car back and forth to distribute evenly then flush bearings with fresh water.

Do not use spray lubricants because ball bearings may skid not roll.

Apply a few drops of McLube® OneDrop™ to ball contact surfaces of track. Roll car back and forth through OneDrop™ several times to distribute onto bearings. Wipe remaining OneDrop™ off track.

OneDrop™ is preferred but you can also use one to two drops of a light machine oil, such as 3-in-1. Too much oil attracts dirt.

Track: Clean with detergent and water.

Important: Exposure to some teak cleaners and other caustic solutions can result in discoloration of part and is not covered under the Harken warranty.



Warranty

For additional safety, maintenance and warranty information see www.harken.com or the Harken® catalog.